


Clamping plates are used in linear conveyor systems. The clamping plates connect seamlessly to the timing belts. The toothed belt ends can be attached to the frame or the part to be moved with the help of the clamping plates.

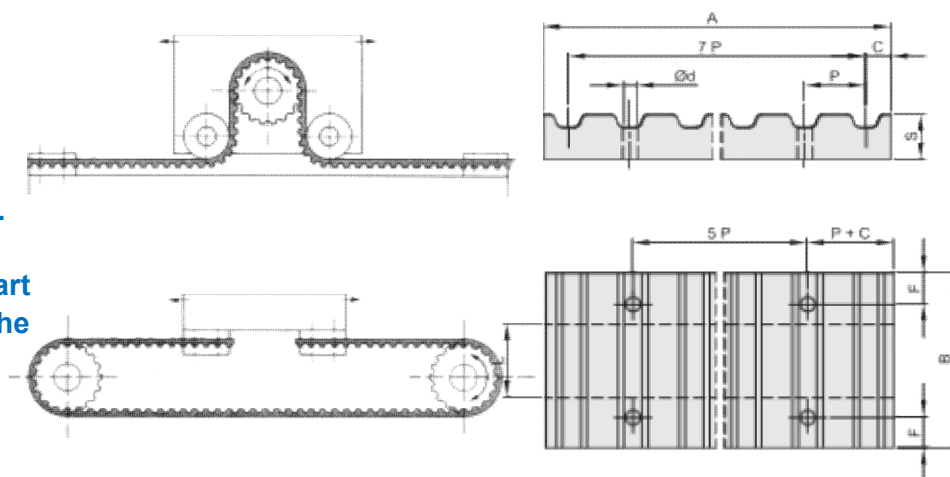

Materiale Alluminio6082-T6

codice	passo	A	B	Ø d	F	C	S	L
XL-025	5.08	42.5	25.5	5.5	6	3.5	8	6.4
XL-037	5.08	42.5	28.5	5.5	6	3.5	8	9.5
L-050	9.525	76.6	39	9	8	5	15	12.7
L-075	9.525	76.6	45	9	8	5	15	19.1
L-100	9.525	76.6	51.5	9	8	5	15	25.4
H-050	12.7	106.9	45	11	10	9	22	12.7
H-075	12.7	106.9	51	11	10	9	22	19.1
H-100	12.7	106.9	57.5	11	10	9	22	25.4
5M-09	5	41.5	28	5.5	6	3.2	8	9
5M-15	5	41.5	34	5.5	6	3.2	8	15
5M-25	5	41.5	44	5.5	6	3.2	8	25
8M-20	8	66	45	9	8	5	15	20
8M-30	8	66	55	9	8	5	15	30
8M-50	8	66	75	9	8	5	15	50
8M-85	8	66	110	9	8	5	15	85
14M-40	14	116	71	11	10	9	22	40
14M-55	14	116	86	11	10	9	22	55
14M-85	14	116	116	11	10	9	22	85
14M-115	14	116	146	11	10	9	22	115
14M-170	14	116	201	11	10	9	22	170
T5-10	5	41.8	29	5.5	6	3.4	8	10
T5-16	5	41.8	35	5.5	6	3.4	8	16
T5-25	5	41.8	44	5.5	6	3.4	8	25
T10-16	10	80	41	9	8	5	15	16
T10-25	10	80	50	9	8	5	15	25
T10-32	10	80	57	9	8	5	15	32
T10-50	10	80	75	9	8	5	15	50
AT5-10	5	41.8	29	5.5	6	3.4	8	10
AT5-16	5	41.8	35	5.5	6	3.4	8	16
AT5-25	5	41.8	44	5.5	6	3.4	8	25
AT10-16	10	80	41	9	8	5	15	16
AT10-25	10	80	50	9	8	5	15	25
AT10-32	10	80	57	9	8	5	15	32
AT10-50	10	80	75	9	8	5	15	50